





- Contactless Absolute 360° (180°) angle measurement
- Incremental mode
- Linear mode
- Standard I2C Interface (100 kHz)
- Programmable resolution up to 13 bit (0.04 degree)
- Verv low hysteresis
- High accuracy mode
- User programmable parameters
- Low power mode
- Sleep and automatic wake-up over I2C
- Programmable zero position
- Device address hardware configurable
- Small Pb-Free package (TSSOP20)
- RoHS compliant

#### **DESCRIPTION**

The KMA36 is a highly reliable universal magnetic position sensor for precise rotational or linear measurement with a resolution up to 0.04 degree. These digital position sensors feature a system-on-chip technology that combines a magnetoresistive element along with analog to digital converter and signal processing in a standard small package. By using Anisotropic Magneto Resistive (AMR) technology, the KMA36 is able to determine accuractly and non-contacting the magnetic angle of an external magnet over 360°, as well as the incremental position on a magnetic pole strip with 5 mm pole length. Its sleep and low power mode as well as automatic wake-up over I2C – make the KMA36 ideal for many battery applications. Position data can be transmitted using a PWM or digital two-wire (SDA, SCL) communication bus. Using the programmable parameters of this digital position sensor, the user can have access to a wide range of configuration to ensure the maximum of freedom and functionalities.

Used as both a linear position sensor or a rotary position sensor, these KMA36 magnetoresistive sensors designed by MEAS (Measurement Specialties) are insensitive to magnetic drift due to mechanical tolerances, changes in temperature or thermal stress. The maintenance-free operation and high bandwidth of this universal magnetic encoder makes it a good choice for dynamic applications in harsh environments.

#### **KEY-FEATURES**


Resolution	13 Bit / 0.04 degree
Operating power supply range of 3V to 5.5V	3.0 – 5.5V
Operating temperature	- 25 - +85 °C
Average current	10 – 30 mA
Sleep current	1.2 mA
Data Update rate	24 – 720 Hz
I <sup>2</sup> C Clockrate	Up to 100 kBit/s

#### **APPLICATIONS**

Industrial environment Harsh environment Handling machine Machine tools Robotics Potentiometer Motor motion control




#### PIN ASSIGNMENT

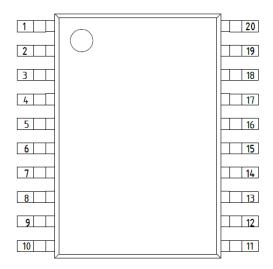

Pin No. KMA36 TSSOP	Symbol	Туре	Description
1	NC	NC	Not connected
2	CS	ı	SPI interface chip select pin
3	DVCC_SE	0	Drive pin to power sensor
4	DI	1	SPI interface data in pin
5	DO	0	SPI interface data out pin
6	SCK	ı	SPI interface clock pin
7	GND_SE	S	Sensor supply ground pin
8	VCC_SE	S	Sensor power supply pin
9	NC	NC	Not connected
10	NC	NC	Not connected
11	NC	NC	Not connected
12	COILP	ı	Coil power supply pin
13	COILN	1	Coil power supply pin
14	AREF	1	Asic analog reference
15	NC	NC	Not connected
16	GND_AS	S	Asic supply ground
17	NC	NC	Not connected
18	VCC_AS	S	Asic power supply
19	DCOILN	0	Drive pin to coil power supply
20	DCOILP	0	Drive pin to coil power supply

Figure 1: Pin assignment

#### **ELECTRICAL CHARACTERISTICS**

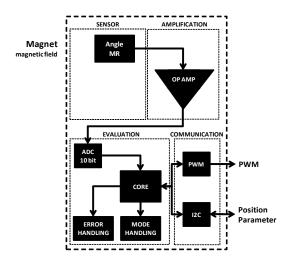

Unless otherwise specified, all voltages are referenced to the power ground supply VSS. Typical values are based on Top= 25 °C, VCC = 5 V. They are given only as design guidelines and are not tested in production. Data based on characterization results, design simulation and/or technology characteristics are indicated in the table footnotes and are not tested in production.

Absolute maximum ratings are limiting values of permitted operation and should never be exceeded under the worst possible conditions either initially or consequently. If exceeded by even the smallest amount, instantaneous catastrophic failure can occur. And even if the device continues to operate satisfactorily, its life may be considerably shortened.

Figure 2: Functional block description



#### **Absolute maximum ratings**

CAUTION: Exceeding these values may destroy the product.

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
T <sub>op</sub>	Operating temperature		- 25		+ 85	°C
T <sub>sto</sub>	Storage temperature		- 40		+ 85	°C
V <sub>cc</sub>	Operating voltage		2.9		6	V
V <sub>in</sub>	Input voltage on any Pin	Except on A1	-0.5		6.5	V
V <sub>in</sub>	Input voltage on A1		-0.5		13	V
I <sub>in</sub>	DC Current through any I/O Pin				40	mA
I <sub>in</sub>	DC Current through S Pin				200	mA
I <sub>in</sub>	DC Current through any C Pin				60	mA

Table 1: Absolute maximum ratings

#### Operating conditions

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
T <sub>op</sub>	Operating temperature		- 25		+ 85	°C
V <sub>cc</sub>	Operating voltage		3		5.5	V
V <sub>in</sub>	Input voltage on I/O pin		-0.3		5.3	V
A <sub>Ref</sub>	External Analog Reference		2.01)		Vcc	V
R <sub>AREF</sub>	Analog Reference input resistance		-	32	-	kΩ

Table 2: Operating conditions

Please refer to the typical application section to know which external components should be connected.

#### • AC/DC characteristics

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
l <sub>avg</sub>	Average current <sup>1)</sup>	Except in sleep mode, $V_{cc} = 5V$	10		30	mA
I <sub>sleep</sub>	Sleep current	$V_{cc} = 5V$		1.2		mA
V <sub>IL</sub>	Input low voltage	$V_{cc} = 5V$ , $I_{OL} = 10$ mA			0.6	V
V <sub>IH</sub>	Input high voltage	V <sub>cc</sub> = 5V, I <sub>OH</sub> = 10 mA	3			V
V <sub>OL</sub>	Output low voltage	$V_{cc} = 5V$ , $I_{OL} = 10$ mA			0.6	V
V <sub>OH</sub>	Output high voltage	V <sub>cc</sub> = 5V, I <sub>OH</sub> = 10 mA	4.3			V

Table 3: AC/DC characteristics

<sup>1)</sup> Apply 2.0V at AREF for best results

<sup>1)</sup> Current measurement has been done with a standard circuit including a voltage divider on AREF.




#### System parameters

Symbol	Parameter Condition Min.		Min.	Тур.	Max.	Unit
f <sub>data</sub>	Update rate <sup>1) 2)</sup>		24		720	Hz
t <sub>start</sub>	Starting time			5		ms
$\alpha_{r}$	Resolution	H <sub>0</sub> =25 kA/m <sup>3)</sup>		13		Bit
Δα <sub>L</sub>	Linearity error	H <sub>0</sub> =25 kA/m <sup>3)</sup> T <sub>op</sub> =25°C		±0.3	±1	o
Δα <sub>Η</sub>	Hysteresis error	H <sub>0</sub> =25 kA/m <sup>3)</sup> T <sub>op</sub> =25°C		±0.1	±0.25	o
$V_{bwn}$	Brown-out reset voltage			2.7		V
t <sub>bwn</sub>	Brown-out reset pulse width			2		μs
Hy	Applied magnetic field		15	25	60	kA/m
R <sub>COIL</sub>	Internal coil resistance		75	100	150	Ω
Δ <sub>PWM</sub>	PWM output resolution			10		bit
f <sub>PWM</sub>	PWM frequency			7.8		kHz

Table 4: System parameters

<sup>3)</sup> System parameters apply only for recommended measurement setup (please refer to the arrangement section)

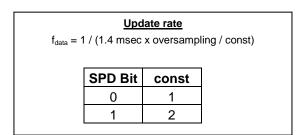

#### **SYSTEM OUTPUT**

The system has two possible hardware output configurations: two-wire interface or analog output.

#### Analog Output

The system has a Pulse Width Modulation unit with 10 bit resolution which can be easily coupled with a first order low-pass filter<sup>1)</sup> to generate an analog output between Vss and Vcc corresponding to 0° and 360°. In this hardware configuration, all internal registers are loaded with initial values. No digital configuration is necessary, all available configurations can be set by changing the hardware setup<sup>2)</sup> of the KMA36.

#### I<sup>2</sup>C (Digital Output)

The KMA36 has an I<sup>2</sup>C Interface unit (two-wire interface, standard I<sup>2</sup>C-bus specification defined by Philips Semiconductors) with an 8-bit data bus which can be easily used to retrieve measurement and configuration information. (Please refer to the two-wire interface section for details)

<sup>1)</sup> Maximum is measured in speed mode with minimum oversampling. Minimum is measured with maximum oversampling.

<sup>&</sup>lt;sup>2)</sup> When using the analog-output configuration then update rate is fixed at 88Hz

<sup>1)</sup> Please refer to the typical application section for further information.

<sup>&</sup>lt;sup>2)</sup> Please refer to the hardware configuration section for further information.



#### TWO WIRE IN INTERFACE

#### • Physical interface parameters

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
B <sub>rt</sub>	Clockrate		10	50	100	kBit/s
AL	Address length			7		bit
As	Address <sup>1)</sup>			0x59		Hex

Table 5: Physical interface parameters

#### Timing parameters

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
t <sub>SU:STA</sub>	Start setup time		4.7			μs
t <sub>HD:STA</sub>	Start hold time		4.0			μs
t <sub>SU:STO</sub>	Stop setup time		4.0			μs
t <sub>HIGH</sub>	Clock high time		4.0		50	μs
t <sub>LOW</sub>	Clock low time		4.7			μs
t <sub>r</sub>	Rise time				1	μs
t <sub>f</sub>	Fall time				0.3	μs
t <sub>SU:DAT</sub>	Data input setup time		0.25			μs
T <sub>HD:DAT</sub>	Data input hold time		0.3			μs
t <sub>BUF</sub>	Bus free time		4.7			μs

Table 6: Start, stop and data timing parameters

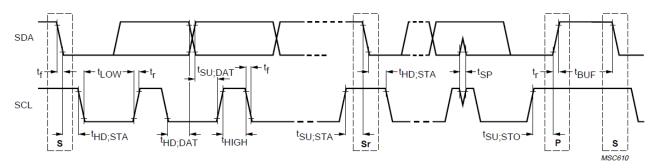


Figure 3: Timing definitions<sup>2)</sup>

<sup>1)</sup> Please refer to the hardware configuration section to determine how to configure other addresses.

<sup>&</sup>lt;sup>2)</sup> Please refer to the standard I<sup>2</sup>C-bus specification defined by Philips Semiconductors for further information.



#### Registers (Overview)

The KMA36 contains the following I/O registers:

Registers of the KMA36-SPI							
Register	Size	Read/Write	Function				
CONF	8 bit	R/W	Configuration bits				
RES	16 bit	R/W	Resolution				
MA	16 bit	R	Magnetic angle				
MIA	32 bit	R	Magnetic incremental angle				

Table 7: Registers of the KMA36

#### I<sup>2</sup>C Bus

The KMA36 is always operating as a pure slave.

#### I<sup>2</sup>C Reading data

It is possible to read up to seven bytes as described in the following figure. No special protocol is used by the reading-data process.

	TWI - Read	d data					
Byte	0	1	2	3	4	5	6
	MA0	MA1	ILC0	ILC1	ILC2	ILC3	KCONF
Read/Write	R	R	R	R	R	R	R
Initial value	0x00	0x00	0x00	0x00	0x00	0x00	0x03

Byte 0:1 - MA1:0: Magnetic angle

Unsigned integer giving the magnetic angle in degree with the configured resolution

Byte 2:5 - ILC3:0: Incremental linear

counter

Signed long giving the incremental linear counter in degree with the configured resolution.

Byte 6 - KCONF: Configuration register

Unsigned char giving the configuration register value.

Table 8: Read data

#### I<sup>2</sup>C Writing data (general)

The KMA36 can be controlled using two internal registers. The configuration (KCONF) is an 8-bit register and the resolution (KRES) is a 16-bit register. To write the 16-bit register (KRES) through the two-wire interface with an 8-bit data bus, it is necessary to send the high byte first and then the low byte.

In order to change the KMA configuration, four bytes should be sent through the two-wire 8-bit data bus. The first three bytes correspond to the configuration and resolution registers. The last byte contains a 8-Bit Cyclic Redundancy Check (CRC) value which can be calculated as described in the example.



TWI - Send data

Byte	0	1	2	3
	KCONF	KRESH	KRESL	KCRC
Read/Write	W	W	W	W
Initial value	-	-	-	-

Byte 0: KCONF: Configuration register Contains the desired system configuration.

Byte 1:2 - KRES: Resolution register Contains the desired resolution.

Byte 3 - KCRC: CRC

Contains the cyclic redundancy check.

Table 9: Send data

#### **Example**

Table 10: CRC Example



#### KCONF (Configuration register)

The configuration register is used to control and monitor the status and modes of the system:

KCONF - Configuration register

	register								
Bit	7	6	5	4	3	2	1	0	
	SLPE	-	LINE	MIAE	LPWRE	SPDE	OVS1	OVS0	
Read/Write	W	R/W	R/W	R/W	R/W	R/W	R/W	R/W	
Initial value	0	0	0	0	0	0	1	0	

Bit 7 - SLPE: Sleep mode enable

Writing this bit to one enables the sleep mode. This bit will be always set to zero by hardware.

Bit 5 - LINE: Linear mode enable

Writing this bit to one disables the rotational mode and enables the linear mode.

Bit 4 - MIAE: Incremental mode

enable

Writing this bit to one enables the incremental angle counter.

By writing it to zero, the counter mode is turned off and the counter set to 0.

Bit 3 - LPWRE: Low power mode

enable

Writing this bit to one enables the low power mode.

Bit 2 - SPDE: Speed mode

enable

Writing this bit to one enables the fast speed mode.

Bit 1:0 - OVS1:0: Oversampling

These bits determines the accuracy of the angle evaluation.

Table 11: KCONF - Configuration Register

The system has three possible main configurations:

Rotational measurement used to measure the angle of a rotating magnet disc centered

above the magnetic sensor center of the KMA36. 1)

Linear measurement used to measure the linear movement of the KMA36 along

a magnetic pole strip with 5mm pole length. A lookup table is used

for internal error correction 1)

• Sleep mode used to power down the KMA36. Wake up is initiated by I<sup>2</sup>C communication

#### • CNT-Bit (KCONF register)

In addition, there is an incremental counter implemented, which can be enabled by writing a one to the CNT-Bit in the KCONF register.

<sup>1)</sup> Please refer to the arrangement section.



#### • SPD-Bit (KCONF register)

The measurement update rate can be increased by activating the fast mode with SPD bit. In fast mode measurement accuracy is reduced.

Update rate f <sub>data</sub> = 1 / (1.4 msec x oversampling / const)					
	SPD Bit	const			
	0	1			
1 2					

Table 12: Update rate

#### • PWR-Bit (KCONF register)

The power current consumption can be reduced with the low power mode accessible through the PWR bit. In low power mode only **180**° measurement are possible.

#### • OVCS-Bits (KCONF register)

To increase the measurement accuracy, it is possible to configure the oversampling rate by using the OVSCx bits. Please notice that a higher accuracy leads to a reduction of the update rate (Please refer to the Update rate table)

OVS1	OVS0	Oversampling
0	0	2
0	1	4
1	0	8
1	1	32

Table 13: OVSC - Oversampling

#### • KRES (Resolution register)

The resolution can be set to any decimal value between 1 and 32768. Any other value would lead to unexpected system behavior.

	KRES - R	Resolution	register					
Bit	15	14	13	12	11	10	9	8
KRESH	KRES15	KRES14	KRES13	KRES12	KRES11	KRES10	KRES9	KRES8
KRESL	KRES7	KRES6	KRES5	KRES4	KRES3	KRES2	KRES1	KRES0
Bit	7	6	5	4	3	2	1	0
Read/Write	W	W	W	W	W	W	W	W
	W	W	W	W	W	W	W	W
Initial value	0	1	1	1	1	1	1	1
	1	1	1	1	1	1	1	1

Bit 15:0 KRES15:0:

Resolution

Table 14: KRES - Resolution Register

For example, a resolution of decimal 360 (0x00168) leads to rotational data in steps of 1 degree. A resolution of decimal 3600 (0x0E10) results in steps of 0.1°.



#### HARDWARE CONFIGURATION

The hardware configuration depends on the desired output: two-wire interface or analog.

In two-wire interface configuration, the slave address of the system can be configured by connecting A0 and another pin as described in following table.

TWI - Slave address configuration

Address		Connection
0x59	A0	GND
0x5A	A0	DCOILP
0x5B	A0	DCOILN
0x5C	A0	DVCC_SE
0x5D	A0	VCC

Table 15: TWI / I<sup>2</sup>C Slave address configuration

In analog mode, the rotation direction can be configured by connecting DVCC\_SE and a power supply pin. The user zero reference angle calibration can be activated by connecting A0 and COILP. When the user zero reference angle calibration is active, the next evaluated magnetic angle will be set as the new zero reference angle. The user selectable output voltage for the zero reference angle can be configured by connecting A0 in series with a 4,7k ohm resistor and a port pin. The percentage indicated is relative to the power supply value Vcc and is defined at the zero reference angle position.

**ANALOG - Rotation direction configuration** 

Direction	Connection		
CW	DVCC SE VCC		
CCW	DVCC_SE	4,7K to GND	

ANALOG - User selectable output for zero reference

Percent	Connection		
0%	A0	4,7K to VCC	
10%	A0	4,7K to DVCC_SE	
25%	A0	4,7K to DCOILN	
50%	A0	4,7K to GND	

ANALOG - Zero reference angle user calibration

Status	Connection		
Active	A0 COILP		
Inactive	A0	-	

Table 16: Analog-Mode configuration



#### TYPICAL APPLICATION

#### • Electrical circuit

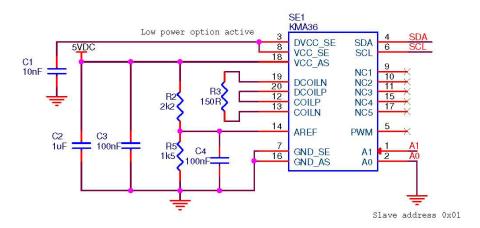


Figure 4: Typical circuit with two-wire interface

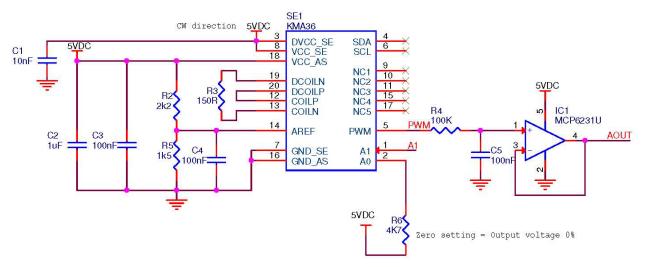


Figure 5: Typical circuit with analog interface




#### **ARRANGEMENT**

Due to the magneto resistive technology which senses the magnetic field in the sensor plane, it is advised to mount the magnet disc centered above the sensor center. Please refer to the magnets and scales section for more information about the magnetic center position of the KMA36. The magnetic scale should be placed perpendicularly to the KMA36 as depicted in the following figure rather in the middle along the width of the scale. For best results the KMA36 should be as close as possible to the magnet.

Rotational (recommended) setup (for best results)



Linear setup

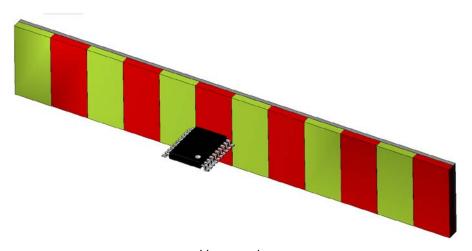

Linear mode
Bit LIN =1
use magnetic pole strip with 5mm pole length for best results

Figure 6: Mounting



#### **MAGNETS AND SCALES**

#### **Rotational Mode**

The KMA36 can be used with a magnet, preferably of disc or square shape or a magnet scale with pole pitch 5mm.

For development purposes, MEAS offers a magnet disc made of plastic bonded Nd-Fe-B magnetic material which provides an homogenous magnetic field with sufficient magnetic field strength for typical application with the KMA36. The following table describes typical magnets parameters. Please refer to the website <a href="http://www.magnetfabrik.de">http://www.magnetfabrik.de</a> (article number 67.044-1 ) and its application note section for more information.

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
Ø	Diameter	Neofer 48/60p only		14		mm
T	Thickness	Neofer 48/60p only		2.5		mm
Br	Magnetic field strength	Neofer 48/60p only		540		mT
Top	Operating temperature	Neofer 48/60p only			150	°C

Table 17a: Typical MEAS disc-magnet specification

#### **Linear Mode**

The linear mode of the KMA36 is designed for a magnetic scale with pole pitch 5mm. A magnetic scale is made of a magnetic ferrite tape bonded on a steel support which guarantees mechanical stability. The steel support is made of an optimum stainless steel alloy that provides no loss of magnetic field strength. MEAS offers a standard scale with the following parameters for development purpose:

Symbol	Parameter	Condition	Min.	Тур.	Max.	Unit
L <sub>T</sub>	Length	MEAS magnetic scale only		1		m
$L_P$	Pole length	MEAS magnetic scale only		5		mm
W	Width	MEAS magnetic scale only		10		mm
Т	Thickness	MEAS magnetic scale only		1.3		mm
Δр	Accuracy	MEAS magnetic scale only		40		μm/m
T <sub>op</sub>	Operating temperature	MEAS magnetic scale only	-40		100	°C

Table 17b: Typical MEAS magnet-scale specification

The correct magnet dimensions and assembly geometry depend on the specific arrangement of the application and are part of the specification of the entire system.



#### **PACKAGE DRAWING**

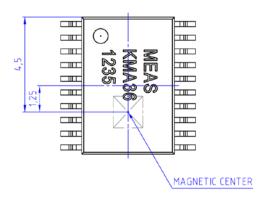


Figure 7: Package drawing (Magnetic center)

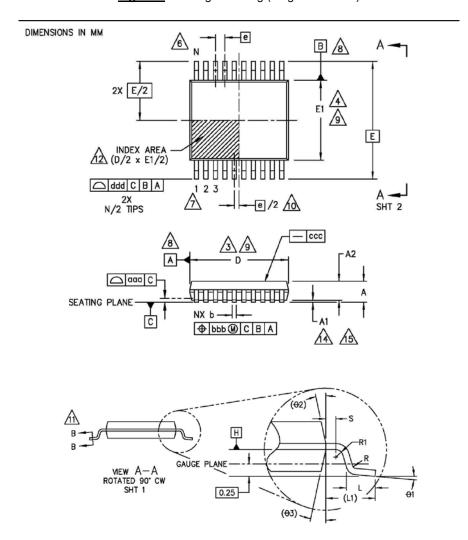


Figure 8: Package drawing



COM	COMMON DIMENSIONS (MILLIMETERS)				
Symbol	Min.	Тур.	Max.		
Α	-	-	1.20		
A1	0.05	-	0.15		
A2	0.80	1.00	1.05		
b	0.19	-	0.30		
D	6.40	6.50	6.60		
E	-	6.40	-		
E1	4.30	4.40	4.50		
е	-	0.65	-		
L	0.45	0.60	0.75		
N	-	20	-		
R	0.09	-	-		
S	0.20	-	-		

Table 18: common dimensions

#### **ORDERING CODE**

Product	Description	Article number
KMA36	KMA36 TSSOP20	G-MRMO-031

Table 19: Ordering codes

This data sheet contains data from the preliminary specification. Supplementary data will be published later. Measurement Specialties reserves the right to change the specification without notice, in order to improve the design and performance of the product.

## **ORDERING INFORMATION**

NORTH AMERICA	EUROPE	ASIA
Measurement Specialties, Inc. 1000 Lucas Way Hampton, VA 23666	MEAS Deutschland GmbH Hauert 13 D-44227 Dortmund	Measurement Specialties China Ltd. No. 26, Langshan Road High-tech Park (North)
United States Phone: +1-800-745-8008	Germany Phone: +49-(0)231-9740-0	Nanshan District, Shenzhen 518057 China
Fax: +1-757-766-4297 Email: sales@meas-spec.com Web: www.meas-spec.com	Fax: +49-(0)231-9740-20 Email: info.de@meas-spec.com Web: www.meas-spec.com	Phone: +86-755-33305088 Fax: +86-755-33305099 Email: info.cn@meas-spec.com
		Web: www.meas-spec.com

The information in this sheet has been carefully reviewed and is believed to be accurate; however, no responsibility is assumed for inaccuracies. Furthermore, this information does not convey to the purchaser of such devices any license under the patent rights to the manufacturer. Measurement Specialties, Inc. reserves the right to make changes without further notice to any product herein. Measurement Specialties, Inc. makes no warranty, representation or guarantee regarding the suitability of its product for any particular purpose, nor does Measurement Specialties, Inc. assume any liability arising out of the application or use of any product or circuit and specifically disclaims any and all liability, including without limitation consequential or incidental damages. Typical parameters can and do vary in different applications. All operating parameters must be validated for each customer application by customer's technical experts. Measurement Specialties, Inc. does not convey any license under its patent rights nor the rights of others.

# AMEYA360 Components Supply Platform

## **Authorized Distribution Brand:**

























## Website:

Welcome to visit www.ameya360.com

## Contact Us:

## Address:

401 Building No.5, JiuGe Business Center, Lane 2301, Yishan Rd Minhang District, Shanghai , China

## > Sales:

Direct +86 (21) 6401-6692

Email amall@ameya360.com

QQ 800077892

Skype ameyasales1 ameyasales2

## Customer Service :

Email service@ameya360.com

## Partnership :

Tel +86 (21) 64016692-8333

Email mkt@ameya360.com